



1 PREPARE 2 TREAT 3 MAINTAIN

WORKTOP KIT

PRODUCT DESCRIPTION

Worktop Kit is used for oil treatment and maintenance of worktops and other indoor wood surfaces. The oil is easy to work with and creates a durable surface with high resistance. The kit contains all you need for the entire treatment.

CONTAINS

- 0.75 L Worktop Oil
- 250 ml Intensive Wood Cleaner
- Black sanding pad
- White polishing pad
- One lint-free cloth
- One pair of gloves
- Work instructions

Product information

Coverage: 0.75L covers approx. 12–15 m² per coat, depending on the absorbency of the wood.

Colours (Oil): Natural



cleaning

Intensive Wood Cleaner

Basic cleaning and grease removal. Prepares surfaces for additional treatment. Reduces the surface tensions, so the following treatment can be done with great result.



resistance

Worktop Oil

Penetrates deep into the wood. Ensures maximum dirt and water resistance from day one. Emphasizes the natural grain for a more attractive look.



application

Easy to apply

The oil is smooth and pleasant to work with. Polishing can be done by hand with a hand scrubber.



maintain

Easy to maintain

Can be cleaned and maintained with WOCA soap and gel for oiled indoor surfaces.



Natural *





WORK DESCRIPTION

Preparation

It is important that both wood and oil have a temperature of min. 15°C (preferably around 20°C) and air humidity of approx. 50 %. Make sure that the room is well-ventilated for optimal evaporation and drying time.

Sand the untreated surface with grit 180. Vacuum clean the surface to remove sanding residue. Thoroughly clean the surface with Intensive Wood Cleaner, mixed 1 part cleaner to 20 parts water. Then wash with clean water. After cleaning, leave the surface to dry for at least 8 hours at 20°C.

Risk of self-ignition




Any cloths that are soaked in oil should be stored/disposed of in sealed containers or incinerated due to risk of self-ignition.

Drying time

The oiled surface can be used after 24 hours at 20°C. During this period, the surface must not come into contact with water. The oil does not harden completely until after about a week. Therefore, treat with care during this period. Any spilled liquids should be wiped up immediately.

Cleaning and maintenance

Weekly cleaning: Natural Soap
Monthly care: Oil Refreshing Soap
Maintenance: Maintenance Gel or Worktop Oil

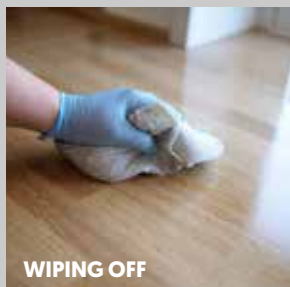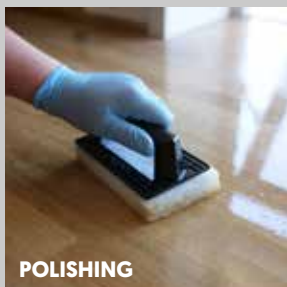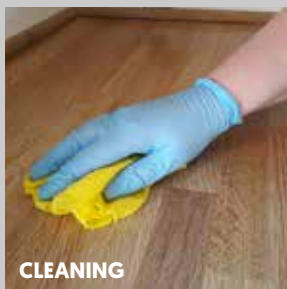

TREATMENT

- 1 Mix the oil thoroughly.
- 2 Use a paintbrush to distribute an appropriate amount of oil in an even, covering coat. If possible, the reverse side of the work surface should also be given a coat of oil.
- 3 Wait approx. 30 minutes at 20°C, while the oil soaks into the wood. Apply more oil if dry areas appear.
- 4 Polish with the red or white WOCA hand scrubber along the direction of the wood grain. This will make the surface more durable.
- 5 Then wipe off all excess oil with a lint-free cotton cloth. No excess oil should remain on the surface.
- 6 Allow the surface to rest for an hour and repeat steps. The surface should be treated two or three times before use. For the final treatment, sand in wet oil with grit 280-400 wet sandpaper, before wiping off with a lint-free cotton cloth.